


## ESTABLISHMENT OF CORNERS ON N. BOUNDARY OF T. 8 N., R. 30 E.

## CHAINS

At easting of 320.00 chs. from the W. boundary of this township, and 6.75 chs. from the cor. of secs. 34 and 35, which is a 2 in. iron post, 10 ins. above ground, marked and witnessed as described by the Surveyor General

Set an iron post, 3 ft. long, 2 ins. in dia., 24 ins. in the ground, for cors. of secs. 2 and 3, with brass cap marked

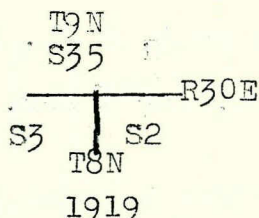

No stone available; pits impracticable.

At easting of 360.00 chs. from the west boundary of this township, and 6.75 chs. from the  $\frac{1}{4}$  sec. cor. sec. 35, which is a 1 in. iron post, 8 ins. above ground, marked and witnessed as described by the Surveyor General.

Set an iron post, 3 ft. long, 1 in. in dia., 26 ins. in the ground, for  $\frac{1}{4}$  sec. cor. sec. 2, with brass cap marked

$\frac{1}{4}$  S2  
1919

The above established cors. were moved from their positions, erroneously determined in the survey of T. 9 N., R. 30 E.

**NOTE:** The latitudinal outboundary bet. secs. 30 and 31, 29 and 32, 21 and 28, 15 and 22 exceeded the limit of 10 minutes from the cardinal; therefore governing sectional correction lines were run east on true lines bet. secs. 19 and 30, 20 and 29, 16 and 21, and 10 and 15, to their intersections with the limiting outboundary, where cors. were set for two sections only. The intermediate sec. and  $\frac{1}{4}$  sec. cors. were set at regular intervals of 40 and 80 chs., throwing the fractional measurement against the old work.

## CHAINS

INDEPENDENT RESURVEY OF SUBDIVISIONS OF T. 8 N., R. 30 E.

From the cor. of secs. 19, 24, 25 and 30, hereinbefore described.

East, on a sectional correction line bet. secs. 19 and 30. Descend broken NE. slope over numerous low spurs and