

Survey of Tract No. 37, T. 11 N., Rs. 48 & 49 E.

Chains

and W. fence; also leave canyon bottom, bears N.30°E. and SW.; continue along rolling S. slope.


18.10 Mouth of small draw from NW.

37.80 Enter canyon bottom, bears NW. and SE.

42.60 Leave canyon bottom, bears NE. and SW.; continue along S. base of ledges.

46.11 Intersect angle point No. 2, identical with cor. No. 2 of listing survey, which is a quartzite boulder, 3x2x2 ft. marked with a cross on top and H 2 on S. face, from which a quartzite boulder, 2½x2½x1 ft., marked W H 2, bears N.26½°E., 16 lks. dist.; and quartzite ledgerrock marked W H 2, bears S.88°W., 31½ lks. dist.

Remove boulder and at same point, on surface rock, cut a cross, over which set an iron post, 3 ft. long, 1 in. dia., 26 ins. in a large mound of stone, for angle point No. 2 of tract No. 37, with brass cap marked

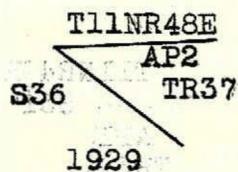

Destroy marks on rock cor.

From angle point No. 2 the standard cor. of T. 11 N.,

Rs. 48 and 49 E., which is a greatly decayed pinon post, 3½ ft. long, 3 ins. dia., blazed on 3 sides, marked TX1 36 on one face and 31 on cornering face,

lying on a small, deeply imbedded mound of stone, bears S. 72°54' E., 27.41 chs. distant. I reconstruct cor. at same point as follows: Set a cedar post, 5 ft. long, 6 ins. diam., squared to 4 ins. for 18 ins. from top, marked SCT11N and 6 grooves on N. face, R49ES31 and 6 grooves on E., and R48ES36 and 6 grooves on W. face, 8 ins. in ground to rock, and supported by a large mound of stone. Place the old post alongside.

Cor. situated on gentle SW. slope on top of low spur, projecting N.85°E.

Thence from angle point No. 2.