

DEPENDENT RESURVEY OF THE SOUTH BDY. OF T. 19 N., R. 50 E.

Chains

Deposit a quart of broken glass at base of post.

Deposit old cor. stake alongside of post.

Thence, S. 89°12' W., on true line with continuous measurement.

70.34

The closing cor. of Tps. 18 N., Rs. 49 and 50 E., which is an iron post, 3 ins. diam., firmly set, mkd. and witnessed as described in the official record.

From this cor., the cor. of Tps. 19 N., Rs. 49 and 50 E., an iron post, 3 ins. diam., firmly set, mkd. and witnessed as described in the official record, bears West, 7.72 chs. dist.

Land, rolling foothills.

Soil, gravelly to rocky; 3rd rate.

Undergrowth, black sage, greasewood.

Timber, scattering juniper.

Grazing, poor.

INDEPENDENT RESURVEY OF THE EAST BDY. OF T. 19 N., R. 50 E.

INDEPENDENT RESURVEY, SUPERSEDING THE SURVEY EXECUTED BY E. B. MONROE, U. S. DEPUTY SURVEYOR, IN 1884. CONTRACT NO. 172

Begin the independent resurvey at the remonumented cor. of Tps. 18 and 19 N., Rs. 50 and 51 E., heretofore described.


Thence,

North, with the reestablishment of the East bdy. of T. 19 N., R. 50 E., bet. secs. 31 and 36.

Over rolling valley floor.

40.00

Set an iron post, 3 ft. long, 1 in. diam., 27 ins. in the ground, for 1/4 sec. cor., with brass cap mkd.

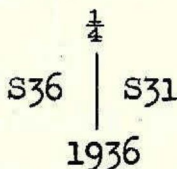

Deposit a quart of broken glass at base of post.

57.90


Graded dirt road, bears N. 40° W. and SE. to Antelope Valley.

74.10

Unimproved road, bears N. 35° E. and S. 35° W.

80.00

Set an iron post, 3 ft. long, 2 ins. diam., 27 ins. in the ground, for cor. of secs. 25, 30, 31, and 36, with brass cap mkd.

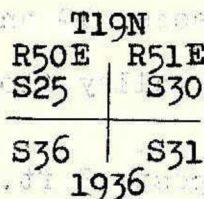

Deposit a quart of broken glass at base of post.