


Dependent Resurvey of the West Boundary, T. 26 N., R. 49 E.

Chains

Reestablishment of the survey executed by Barker and Bridges in 1879. Beginning at the closing cor. of Ts. 25 and 26 N., Rs. 48½ and 49 E., a 3 in. iron post, set, mkd. and witnessed as described in the official record of the resurvey of the 5th Standard Parallel North, through R. 49 E., in 1922.

As this corner is to become the NW. corner of sec. 1, T. 25 N., R. 48½ E., and an angle point in the E. bdy. of sec. 36, T. 26 N., R. 48 E., I change the markings on the cap to read:

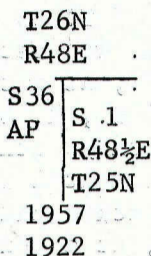

from which

The cor. of secs. 25 and 36, T. 26 N., R. 48 E., a point established by Hatch and Eaton in 1869 and remonumented with a 2 in. iron post by Swanholm in 1922, bears N., 2.46 chs. dist. I remove all evidence of this corner.


S. 89° 53' E., along the N. bdy. of sec. 1, T. 25 N., R. 48½ E.

Desc. 30 ft. over gradual SE. slope, through heavy sagebrush.

5.85 Point for the SW. cor. of T. 26 N., R. 49 E., at proportionate dist.; there is no evidence of the original corner or of the 1 in. iron post set in 1922 and marked WP.

At the corner point

Set an iron post, 30 ins. long, 2½ ins. diam., 22 ins. in the ground, with brass cap mkd.

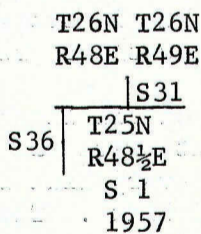

Deposit broken glass alongside iron post.

from which

The standard ¼ sec. cor. of sec. 31, T. 26 N., R. 49 E., bears S. 89° 53' E., 47.37 chs. dist., monumented with a 1 in. iron post, set, mkd. and witnessed as described in the official record of the resurvey of the 5th Standard Parallel North, through R. 49 E.

N. 0° 31' W., along the W. bdy. of sec. 31.

Over rolling hills, through heavy sagebrush and thinly scattered timber.

3.70 Wash, 10 lks. wide, 2 ft. deep, drains SE.

Asc. 85 ft. over E. slope.